

MINE SIGNS ID LABEL FITMENT GUIDE

ITEMS REQUIRED –

1. Quick drying evaporative cleaning product such as Prepsol.
2. Clean rags to clean surface
3. Masking tape (50mm)
4. Scissors
5. Squeegee
6. Tape Measure




A CLEAN SURFACE IS KEY TO FULL ADHESION FOR LONG SERVICE LIFE OF THE ID LABEL

APPLICATION STEPS –


- Step 1** Use Prepsol and rags to thoroughly clean surface.



- Step 2** Use measuring tape to mark label position.

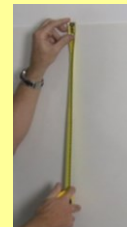

- Step 3** Position sign without removing the backing paper and use a tab of masking tape at each side on the vertical edge to hold the ID Label in position.

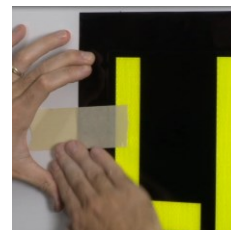


- Step 4** When you are happy with the position of the ID label, place a strip of masking tape vertically across the full length of the ID Label just past centre to ensure the label doesn't move.




Step 5

Cut the masking tape tab on the right side edge of the sticker so you can fold the sticker back toward you half way.

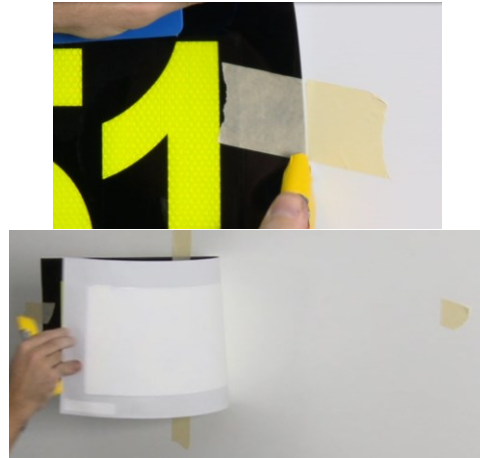

Step 6

Peel the backing paper off the label, cutting the excess paper off with your scissors.

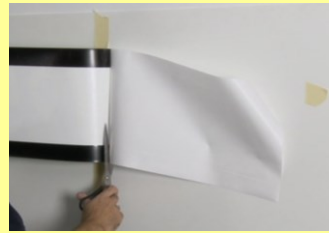

Step 7

Lay the label back on to the surface carefully realigning your masking tape to ensure your label is straight.



Step 8


Holding the right hand edge of the label off the surface, use your squeegee and start rubbing the surface using a centre out motion toward the right hand edge.



*****Holding the right hand edge of the label off the surface, this ensures that as you squeegee out, it releases any air bubbles from getting trapped*****

Step 9

Remove the centre strip of masking tape and repeat steps 3 through 7 only this time on the left hand side of the ID Label.

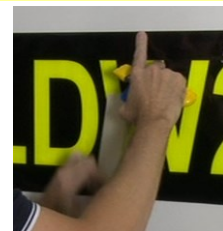

Step 10

Remove all excess masking tape and squeegee the outside edges ensuring full adhesion contact is made.

